


MILLING MACHINES

GANTRY TYPE

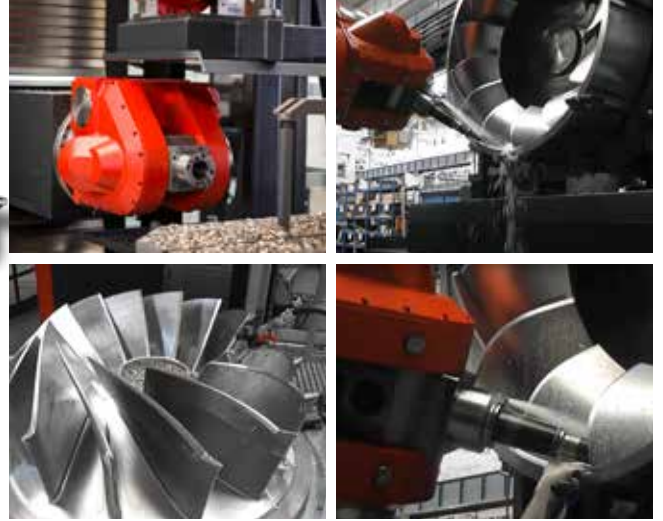

| GANTRY TYPE | | FUT 150 | FUT 150-125 | FUT 200 | FUT 200-125 |
|--------------------------------|----------|---|---|---|---|
| Working travel X- longitudinal | (mm) | 3000 / 4000 / 5000 | 3000 / 4000 / 5000 | 3000 / 4000 / 5000 | 3000 / 4000 / 5000 |
| Working travel Y- cross | (mm) | 2000 / 2500 / 3000 | 2000 / 2500 / 3000 | 2000 / 2500 / 3000 | 2000 / 2500 / 3000 |
| Working travel Z- vertical | (mm) | 1500 | 1500 | 2000 | 2000 |
| Working travel W | (mm) | - | 1250 / 1500 | - | 1250 / 1500 |
| Table clamping surface | (mm) | 1600 × 1800 / 1800 × 2200 / 2000 × 2400 | 1600 × 1800 / 1800 × 2200 / 2000 × 2400 | 1600 × 1800 / 1800 × 2200 / 2000 × 2400 | 1600 × 1800 / 1800 × 2200 / 2000 × 2400 |
| Feed- range X / Y / Z / W | (mm/min) | 1 ÷ 20000 (30000) | 1 ÷ 20000 (30000) | 1 ÷ 20000 (30000) | 1 ÷ 20000 (30000) |
| Motor output | (kW) | 30 / 37 / 45 | 30 / 37 / 45 | 30 / 37 / 45 | 30 / 37 / 45 |

| GANTRY TYPE | | FU(Q)-A | FU(Q)-B |
|--------------------------------|----------|--|----------------------------------|
| Working travel X- longitudinal | (mm) | 4000 ÷ 24000 (then 1000) | 4000 ÷ 24000 (then 1000) |
| Working travel Y- cross | (mm) | 1400 / 2000 / then per 500 up to 5000 | 4000 then per 1000 up to 8000 |
| Working travel Z- vertical | (mm) | 1250 / 1500 / 2000 | 1600 / 2000 |
| Table clamping surface | (mm) | (optional) | (optional) |
| Feed- range X | (mm/min) | 1 ÷ 20000 | 1 ÷ 15000 |
| Feed- range Y | (mm/min) | 1 ÷ 20000 | 1 ÷ 15000 |
| Feed- range Z | (mm/min) | 1 ÷ 20000 / 15000 / 12500 | 1 ÷ 15000 |
| Feed- range W | (mm/min) | - | 1 ÷ 10000 |
| Motor output | (kW) | 30 / 37 / 45 | 60 |

